
The logo for Seabee Service News features the word "Seabee" in a large, bold, italicized font with a yellow and black striped background. To the right of "Seabee" is a stylized illustration of a bee. Below "Seabee" is the word "Service News" in a smaller, italicized font.

REPUBLIC AVIATION CORPORATION
FARMINGDALE, LONG ISLAND, NEW YORK
SERVICE DEPARTMENT

November 14, 1946

DISTRIBUTORS BULLETIN No.13

FIREWALL TERMINAL BLOCK

The terminal block mounted on the forward right hand side of the firewall is held in place with three screws and is insulated from the firewall with a flat insulation strip on the top and bottom. One incident has occurred where the attaching screws became loose and permitted the block to shift so that a terminal shorted out on the firewall. Therefore, it is recommended that a periodic check of the tightness of these screws be made as well as a check to determine that the insulation strips have not shifted.

Future airplanes will be delivered with a different type insulator which will entirely eliminate this possibility. Kits containing the necessary parts will be delivered as soon as possible so that this modification can be made retroactively on airplanes already delivered.

Please advise any Seabee owners in your territory of this condition.

W. H. Ehmann
Service Manager