

REPUBLIC AVIATION CORPORATION FARMINGDALE, LONG ISLAND, NEW YORK SERVICE DEPARTMENT

FEBRUARY 5, 1947

MANDATORY CHANGE

SERVICE BULLETIN NO. 7

INSTALLATION IMPROVED FUEL STRAINER DRAIN

<u>REASON FOR CHANGE:</u> To provide a strainer drain which is leakproof, airtight and which does not

require safetying.

AIRPLANES AFFECTED: Republic Serial Nos. 5 through 250 inclusive. Serial Nos. 251 and up have

already had this change accomplished in production.

<u>DESCRIPTION OF CHANGE:</u> This change involves removing present fuel strainer drain cock or plug

and installing a new drain with adapter and shall be accomplished as

follows:

1. Remove existing drain cock or plug from the fuel strainer located near the right hand wing fairing.

- 2. Install Adapter 17P65058-1 in the strainer and install W7600-1/8 drain cock in end of adapter. Use seal-lube when installing these parts.
- 3. Make suitable entry in log book.

PARTS REQUIRED: Parts may be obtained through your local dealer or distributor, at no charge.

SERVICE BULLETIN KIT NO. 7 consists of the following:

<u>PART NUMBER</u>	PART NAME
17P65058-1	Adapter
W7600-1/8	Drain Cock
	17P65058-1

W. H. EHMANN SERVICE MANAGER

IF YOU HAVE SOLD YOUR AIRPLANE, PLEASE FORWARD THIS BULLETIN TO THE PRESENT OWNER.